
CL1080 LONER®

Temperature Controlled SOLDERING INSTRUMENT

- 120V, 60Hz, 70W, 5 Oz (142 gm)
- TEMP. RANGE: 400°F 800°F (205°C 427°C)
- TEMP. REGULATION: ±6°F (±3°C)
- TIP TO GROUND LEAKAGE: < 2MV
- TIP TO GROUND RESISTANCE: < 2 OHMS
- COMPLIES WITH DOD-STD-2000-1B, MIL-STD-2000A and ESD SPEC. DOD-STD 1868, DOD-HDBK-263



930 Soldering Station includes CL1080 and IP329

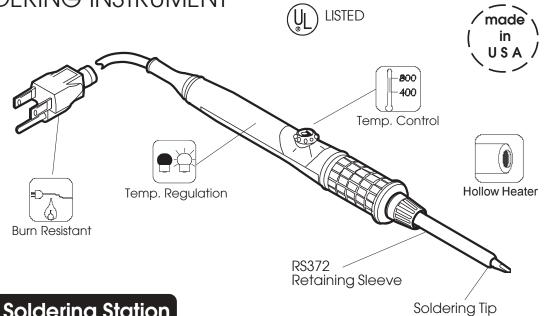


- 1. Plug-in Tool. Set to desired temperature. (Blinking lamp means set temperature is reached.)
- 2. TIN the Tip (apply solder) before soldering.
- 3. Do not rub, bend or file Tip.
- 4. Always clean the Tip by wiping it against the saturated sponge, then re-tin.
- 5. ALWAYS RE-TIN THE TIP BEFORE AND AFTER USING.


Distributed by:

All-Spec Industries Ph: 800-537-0351 Web: www.all-spec.com Wilmington, NC Fx: 800-379-9903 Email: sales@all-spec.com

CHANGING TIP


- 1. MAKE SURE YOUR TOOL IS COOL!
- 2. Turn **R\$372** counterclockwise to remove.
- 3. Remove old Soldering Tip.
- 4. Insert new Tip.
- 5. Install RS372. (should be "finger" tight only.)



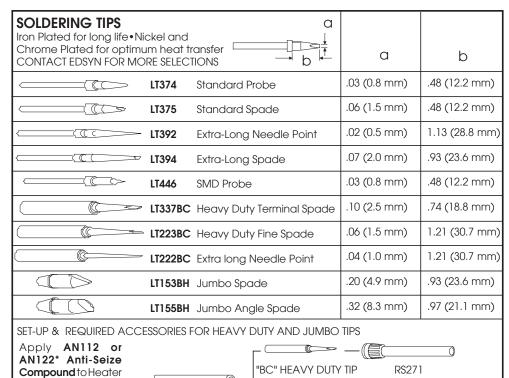



Fine point tip for SMD soldering.



Large and heavy tip for heavy duty soldering.

AC735 TA350 JUMBO TIP RS351

MAINTENANCE

• Replace R\$199 Cleaning Sponge


*AN122 Anti-Seize Compound comes in

and area of Tip con-

syringe dispenser.


tact.

- 1. Fill water only up to the top of the RS243 Leveling Pad.
- 2. Depress R\$199 to moisten it completely.

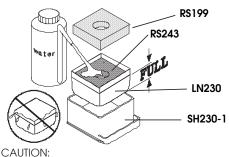


Over-filling can cause thermal shock to the tip or heating element during tip cleaning.

- Replace SC581 Solder Collector
- 1. Hold the Housing firm and turn Cap counter-clockwise and pull it away from the Housing.
- 2. Remove used **SC581** and replace with a new one.
- 3. Reassemble Pod with TOP of the Cap in proper position.



To replace Pod, press Release Tab and slide out Pod.



Distributed by: All-Spec Industries Wilmington, NC

Ph: 800-537-0351 Fx: 800-379-9903


Web: www.all-spec.com
Email: sales@all-spec.com

TEMPERATURE CALIBRATION

AIR MOVEMENT WILL AFFECT THE TEMPERATURE READING.

WORK IN AN AREA WHERE THIS IS MINIMUM.

- 1. Use the **D\$299\$** to remove the temperature control knob. Turn Temp. Control **(A)** so arrow points to cord.
- 2. Use the **SRW01** to pull out heater assembly, PCB & power cord from handle. Leave enough power cord slack to install **SRF30**.



- 3. Place heater assembly, PCB & power cord inside **SRF30**. Install tip that is clean and well tinned.
- 4. With the use of the MS412 Temperature Caliration System. Follow set-up shown below.
- 5. Plug in tool and by using the Pot Adjustment Tool supplied, turn Temp. Control **(A)** to "solder-melt" temperature.
- 6. Apply a small amount of solder on the Tip, just enough to form a solder bead on top of the Tip. Place the center of the thermocouple wire of the on top of the solder bead.
- 7. Again, apply a small amount of solder on the center of the cross wire, just enough to embed the center.
- 8. Turn Temp. Control **(A)** fully clockwise. Adjust Calibration Pot **(B)** until reading stabilizes at 800°F.
- 9. Assemble unit in original handle.
- 10. Before installing the Temp. Control Knob, peel-off pointer label from the Knob.
- 11. Using same MS412 set-up, install and adjust Temp. Control Knob so Meter will read desired temperature.
- 12. Attach new pointer label in accordance with the reading of the Meter.


Tools Needed

- •SRW01
- •DS299S
- •SRF30
- •MS412
- •Pot Adjustment Tool



POINTER LABEL



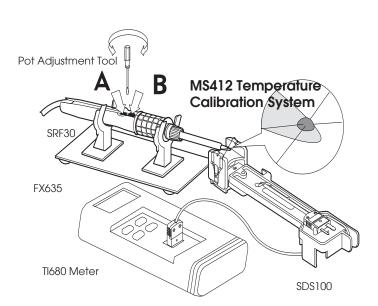


Distributed by: All-Spec Industries Wilmington, NC

Ph: 800-537-0351 Fx: 800-379-9903 Web: www.all-spec.com
Email: sales@all-spec.com


TIP CLEANING To maintain proper Tip to Ground resistance.

- 1. Remove Tip from Heater Assembly.
- 2. Using a **ST707 Soldering Tool Maintenance Brush**, clean Tip and Heater Barrel at surfaces shown.
- 3. Install the tip and tighten RS372 Retaining Sleeve. Take note of the gap to ensure proper fitting.



If there is no gap, try replacing the $\mbox{\bf RS372}$ Retaining Sleeve.






CL1080 LONER Soldering Instrument Spare Parts List

Disassembly of this Tool will require the use of **SRW01** Heater Removal Tool.



ITEM NO.	PART NO.	DESCRIPTION	QTY
1	LT375	LONER® Standard Spade Soldering Tip	1
2	RS372	Retaining Sleeve Assembly (RS382 & RB386)	1
2a	RS382	Retaining Sleeve	1
2b	RB386	Retaining Bushing	1
3	SR070	120 V Hollow Heater Assembly	1
4	SR081	Vinyl Finger Grip for Retaining Collar.	1
5	RC334	Threaded Retaining Collar for Heater Assy.	1
6	SR028	Power Cord, 3-Prong, 120 VAC 1	
7	SR029	Boot for Power Cord	1
8	SR030	Clear Handle for Model 930	1
9	SR031	Knob, Temperature Control for Clear Handle	1
10	SR111	Logo, Pointer, 3/8" Dia. Self Adhesive	1
11	SR032	Cord Strain Relief	1
12	SR033	Circuit Board, Model 930	1

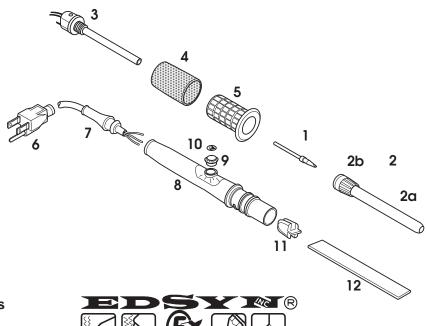

All-Spec Industries PH: 800-537-0351 FX: 800-379-9903 sales@all-spec.com www.all-spec.com

Distributed by:

15958 ARMINTA ST. VAN NUYS, CA 91406-1896 PHONE: 818.989.2324 FAX (sales): 818.997.0895 Email: info@edsyn.com Internet: www.edsyn.com