

Safety Data Sheet

FOR REGULATORY AND SDS QUESTIONS (U.S. AND CANADA):

CALL THE PRODUCT STEWARDSHIP LINE 1-908-791-2336 9 AM TO 6 PM ET (Mon-Fri)

Section 1. Identification

Product name : 985M Soldering Flux

Product code : 4060017
Product type : Liquid.

Date of issue/Date of : March 10 2023.

revision

Manufacturer - Supplier	Telephone no.:	Emergency phone:
Alpha Assembly Solutions Inc. 800 West Thorndale Avenue Itasca, IL 60143 USA	\$00-253-7837 1-630-616-4000	DOMESTIC NORTH AMERICA 202-464-2554
ALPHA METALS MEXICO SA DE CV Ave Nafta 800, Parque Industrial STIVA Apodaca NL 66600 Mexico	Tel: +52 81 1156-6602	Tel: 01 800 022 1400 Tel: +52 55 5559-1588
Alpha Assembly Solutions Brasil Soldas Ltda Rio Jaguarão, 1540 - Vila Buriti Manaus Amazonas 69072-055 Brasil	Tel: 55 92 3614-7400	Tel: 55 92 3614-7423

Section 2. Hazards identification

OSHA/HCS status

: This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).

Classification of the substance or mixture

: FLAMMABLE LIQUIDS - Category 2 EYE IRRITATION - Category 2A

SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3

AQUATIC HAZARD (ACUTE) - Category 3 AQUATIC HAZARD (LONG-TERM) - Category 3

GHS label elements

Hazard statements

Hazard pictograms





Signal word : Danger

: Mighly flammable liquid and vapor.
Causes serious eye irritation.
May cause drowsiness or dizziness.

Harmful to aquatic life with long lasting effects.

Precautionary statements

Prevention

: Wear protective gloves, protective clothing and eye or face protection. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use explosion-proof electrical, ventilating or lighting equipment. Use non-sparking tools. Take action to prevent static discharges. Use only outdoors or in a well-ventilated area. Avoid release to the environment. Avoid breathing vapor. Wash thoroughly after handling.

985M Soldering Flux Page: 2/12 4060017 March 10 2023.

Section 2. Hazards identification

Response

: IF INHALED: Remove person to fresh air and keep comfortable for breathing. Call a POISON CENTER or doctor if you feel unwell. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If eye irritation persists: Get medical advice or attention.

Storage

: Store locked up. Store in a well-ventilated place. Keep container tightly closed. Keep cool.

Disposal

: Dispose of contents and container in accordance with all local, regional, national and international regulations.

Supplemental label elements

: Avoid contact with skin and clothing. Wash thoroughly after handling.

Hazards not otherwise classified

: Prolonged or repeated contact may dry skin and cause irritation.

Section 3. Composition/information on ingredients

Substance/mixture

Mixture

Ingredient name	%	CAS number
sopropyl alcohol	80-100	67-63-0
Solvent naphtha (petroleum) heavy aliph.	1-10	64742-96-7
Proprietary petroleum distillate	1-10	-
succinic acid	1-10	110-15-6
Ethoxylated alcohol.	0.1-1.0	-

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of necessary first aid measures

Eye contact

: Check for and remove any contact lenses. Immediately flush eyes with running water for at least 30 minutes, keeping eyelids open. Get medical attention.

Inhalation

: Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that mists are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention. If necessary, call a poison center or physician. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

Skin contact

: Wash skin thoroughly with soap and water or use recognized skin cleanser. Remove contaminated clothing and shoes. Get medical attention if symptoms occur. Wash clothing before reuse. Clean shoes thoroughly before reuse.

Ingestion

: Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Get medical attention. If necessary, call a poison center or physician. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

985M Soldering Flux Page: 3/12 4060017 March 10 2023.

Section 4. First aid measures

Most important symptoms/effects, acute and delayed

Potential acute health effects

Eye contact : Causes serious eye irritation.

Inhalation : Can cause central nervous system (CNS) depression. May cause drowsiness or

dizziness.

Skin contact : Defatting to the skin. May cause skin dryness and irritation.

: Can cause central nervous system (CNS) depression. Ingestion

Over-exposure signs/symptoms

Eye contact : Adverse symptoms may include the following:

> pain or irritation watering redness

Inhalation : Adverse symptoms may include the following:

nausea or vomiting

headache

drowsiness/fatique dizziness/vertigo unconsciousness

Skin contact Adverse symptoms may include the following:

> irritation dryness cracking

Ingestion : No specific data.

Indication of immediate medical attention and special treatment needed, if necessary

Notes to physician : Treat symptomatically. Contact poison treatment specialist immediately if large

quantities have been ingested or inhaled.

Specific treatments : No specific treatment.

Protection of first-aiders No action shall be taken involving any personal risk or without suitable training. If it is

suspected that mists are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to

give mouth-to-mouth resuscitation.

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media

Suitable extinguishing

media

: Use dry chemical, CO2, water spray (fog) or foam.

Unsuitable extinguishing

media

: Do not use water jet.

Specific hazards arising from the chemical

: Highly flammable liquid and vapor. Runoff to sewer may create fire or explosion hazard. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. This material is harmful to aquatic life with long lasting effects. Fire water contaminated with this material must be contained and prevented

from being discharged to any waterway, sewer or drain.

Hazardous thermal decomposition products : Decomposition products may include the following materials:

carbon dioxide carbon monoxide

halogenated compounds

985M Soldering Flux Page: 4/12 4060017 March 10 2023.

Section 5. Fire-fighting measures

Special protective actions for fire-fighters

: Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.

Special protective equipment for fire-fighters : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

For non-emergency personnel

: No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing vapor or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.

For emergency responders: If specialized clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For nonemergency personnel".

Environmental precautions

: Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air). Water polluting material. May be harmful to the environment if released in large quantities.

Methods and materials for containment and cleaning up

Small spill

: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.

Large spill

: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

Precautions for safe handling

Protective measures

Fut on appropriate personal protective equipment (see Section 8). Do not ingest. Avoid contact with eyes, skin and clothing. Avoid breathing vapor or mist. Avoid release to the environment. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. Empty containers retain product residue and can be hazardous. Do not reuse container.

985M Soldering Flux Page: 5/12 4060017 March 10 2023.

Section 7. Handling and storage

Advice on general occupational hygiene Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

including any incompatibilities

Conditions for safe storage, : Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Eliminate all ignition sources. Separate from oxidizing materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits

sopropyl alcohol

ACGIH TLV (United States, 3/2017). Notes: Refers to Appendix A -

- Carcinogens. ACGIH 2003 Adoption

STEL: 400 ppm 15 minutes. TWA: 200 ppm 8 hours.

NIOSH REL (United States, 10/2016).

STEL: 1225 mg/m³ 15 minutes. STEL: 500 ppm 15 minutes. TWA: 980 mg/m³ 10 hours. TWA: 400 ppm 10 hours.

OSHA PEL (United States, 6/2016).

TWA: 980 mg/m³ 8 hours. TWA: 400 ppm 8 hours.

OSHA PEL 1989 (United States, 3/1989).

STEL: 1225 mg/m³ 15 minutes. STEL: 500 ppm 15 minutes. TWA: 980 mg/m³ 8 hours. TWA: 400 ppm 8 hours.

Proprietary petroleum distillate

OSHA PEL (United States). TWA: 500 ppm 8 hours.

ACGIH TLV (United States, 3/2017). Absorbed through skin.

TWA: 200 mg/m³, (as total hydrocarbon vapor) 8 hours.

Appropriate engineering controls

: Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.

Environmental exposure controls

: Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures

Hygiene measures

: Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.

985M Soldering Flux Page: 6/12 4060017 March 10 2023.

Section 8. Exposure controls/personal protection

Eye/face protection

: Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: chemical splash goggles.

Skin protection

Hand protection

: Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.

Body protection

Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear antistatic protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.

Other skin protection

: Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.

Respiratory protection

: Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

Section 9. Physical and chemical properties and safety characteristics

The conditions of measurement of all properties are at standard temperature and pressure unless otherwise indicated.

Appearance

Physical state : Liquid.

Color : Yellow. [Light]
Odor : Alcohol-like.
Odor threshold : Not available.

pH : 3

Melting point/freezing point : Not available.

Boiling point, initial boiling : 82°C (179.6°F)

point, and boiling range

Flash point : Closed cup: 12°C (53.6°F)

Evaporation rate : Not available.
Flammability : Not available.
Lower and upper explosion : Not available.
limit/flammability limit

Vapor pressure

: **∦**.3 kPa (32.25258 mm Hg)

Relative vapor density : Not available.

Relative density : 0.809

Solubility : Not available.

Miscible with water : Mo.

VOC : 772.1 g/l

Partition coefficient: n-

octanol/water

: Not applicable.

Auto-ignition temperature : 210°C (410°F)

985M Soldering Flux Page: 7/12 4060017 March 10 2023.

Section 9. Physical and chemical properties and safety characteristics

Decomposition temperature : Not available.
Viscosity : Not available.
Flow time (ISO 2431) : Not available.

Particle characteristics

Median particle size : Not applicable.

Section 10. Stability and reactivity

Reactivity

Chemical stability

Possibility of hazardous

reactions

Conditions to avoid

Incompatibility with various substances

Hazardous decomposition products

Hazardous polymerization

: No specific test data related to reactivity available for this product or its ingredients.

: The product is stable.

: Under normal conditions of storage and use, hazardous reactions will not occur.

: Avoid all possible sources of ignition (spark or flame). Do not pressurize, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition.

: Reactive or incompatible with the following materials: oxidizing materials, acids and

: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

: Under normal conditions of storage and use, hazardous polymerization will not occur.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
Isopropyl alcohol	LD50 Dermal	Rabbit	6290 mg/kg	-
	LD50 Oral	Rat	4.7 g/kg	-
succinic acid	LD50 Oral	Rat	2260 mg/kg	-
Ethoxylated alcohol.	LC50 Inhalation Vapor	Rat	>20 mg/l	1 hours
	LD50 Dermal	Rabbit	>2000 mg/kg	-
	LD50 Oral	Rat	2 g/kg	-
	LD50 Oral	Rat	>2000 mg/kg	-

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
Isopropyl alcohol	Eyes - Moderate irritant	Rabbit	-	24 hours 100 milligrams	-
	Eyes - Moderate irritant	Rabbit	-	10 milligrams	-
	Eyes - Severe irritant	Rabbit	-	100 milligrams	-
	Skin - Mild irritant	Rabbit	-	500 milligrams	-
succinic acid	Eyes - Severe irritant	Rabbit	-	750 Micrograms	-

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

985M Soldering Flux Page: 8/12 4060017 March 10 2023.

Section 11. Toxicological information

Classification

Product/ingredient name	OSHA	IARC	NTP
Isopropyl alcohol	-	3	-

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Product/ingredient name	3 3 3	Route of exposure	Target organs
Sopropyl alcohol	Category 3	-	Narcotic effects

Specific target organ toxicity (repeated exposure)

Not available.

Aspiration hazard

Product/ingredient name	Result
Solvent naphtha (petroleum) heavy aliph.	ASPIRATION HAZARD - Category 1
Proprietary petroleum distillate	ASPIRATION HAZARD - Category 1

Information on the likely routes of exposure

: Eye contact. Inhalation. Ingestion.

Potential acute health effects

Eye contact

: Causes serious eye irritation.

Inhalation

: Can cause central nervous system (CNS) depression. May cause drowsiness or

dizziness.

Skin contact

: Defatting to the skin. May cause skin dryness and irritation.

Ingestion

: Can cause central nervous system (CNS) depression.

Symptoms related to the physical, chemical and toxicological characteristics

Eye contact

: Adverse symptoms may include the following:

pain or irritation

watering redness

Inhalation

: Adverse symptoms may include the following:

nausea or vomiting

headache

drowsiness/fatigue dizziness/vertigo unconsciousness

Skin contact

: Adverse symptoms may include the following:

irritation dryness cracking

Ingestion

: No specific data.

Delayed and immediate effects and also chronic effects from short and long term exposure

Short term exposure

Potential immediate

: Not available.

effects

Potential delayed effects : Not available.

985M Soldering Flux Page: 9/12 4060017 March 10 2023.

Section 11. Toxicological information

Long term exposure

Potential immediate

: Not available.

effects

Potential delayed effects : Not available.

Potential chronic health effects

Not available.

General: Frolonged or repeated contact can defat the skin and lead to irritation, cracking and/or

dermatitis.

Carcinogenicity : No known significant effects or critical hazards.
 Mutagenicity : No known significant effects or critical hazards.
 Reproductive toxicity : No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

Route	ATE value
⊘ ral	5243.21 mg/kg

Section 12. Ecological information

Toxicity

Product/ingredient name	Result	Species	Exposure
sopropyl alcohol	Acute EC50 10100 mg/l Fresh water	Daphnia - Daphnia magna	48 hours
	Acute LC50 1400000 µg/l Marine water	Crustaceans - Crangon crangon	48 hours
	Acute LC50 4200 mg/l Fresh water	Fish - Rasbora heteromorpha	96 hours
Proprietary petroleum distillate	Acute LC50 2200 μg/l Fresh water	Fish - Lepomis macrochirus	4 days
succinic acid	Acute EC50 374200 μg/l Fresh water	Daphnia - Daphnia magna - Larvae	48 hours
Ethoxylated alcohol.	Acute EC50 0.39 mg/l Fresh water	Crustaceans - Ceriodaphnia dubia - Neonate	48 hours
	Acute EC50 302 μg/l Fresh water	Daphnia - Daphnia magna - Neonate	48 hours
	Acute LC50 1400 µg/l Fresh water	Fish - Pimephales promelas	96 hours
	Chronic NOEC 83 µg/l Fresh water	Daphnia - Daphnia magna - Neonate	21 days

Persistence and degradability

Not available.

Bioaccumulative potential

Product/ingredient name	LogPow	BCF	Potential
 opropyl alcohol	0.05	-	low
succinic acid	-0.59	-	low
Ethoxylated alcohol.	2.03 to 6.24	-	high

Mobility in soil

Soil/water partition coefficient (Koc)

: Not available.

985M Soldering Flux Page: 10/12 4060017 March 10 2023.

Section 12. Ecological information

Other adverse effects

: No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods

: The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapor from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Section 14. Transport information

	DOT Classification	TDG Classification	Mexico Classification	UN	IMDG	IATA
UN number	UN1219	UN1219	UN1219	UN1219	UN1219	UN1219
UN proper shipping name	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution
Transport hazard class(es)	3	3	3	3	3	3
Packing group	II	II	II	II	II	II
Environmental hazards	No.	No.	No.	No.	No.	No.

Additional information - DOT Classification	ERG# 129

Special precautions for user: Transport within user's premises: always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

985M Soldering Flux
4060017 Page: 11/12
March 10 2023.

Section 15. Regulatory information

U.S. Federal regulations : TSCA 5(a)2 proposed significant new use rule (SNUR): No products were found.

TSCA 5(a)2 final significant new use rule (SNUR): No products were found.

TSCA 12(b) one-time export notification: No products were found. TSCA 12(b) annual export notification: No products were found.

United States inventory

(TSCA 8b)

: All components are listed or exempted.

SARA 302/304

Composition/information on ingredients

No products were found.

SARA 311/312

Classification : FLAMMABLE LIQUIDS - Category 2

EYE IRRITATION - Category 2A

SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3

HNOC - Defatting irritant

California Prop. 65

⚠ WARNING: Cancer and Reproductive Harm - www.P65Warnings.ca.gov.

Canada

Canada inventory : All components are listed or exempted.


International regulations

Inventory list

Australia : Not determined.
China : Not determined.
Japan : Not determined.
New Zealand : Not determined.
Philippines : Not determined.
Republic of Korea : Not determined.
Taiwan : Not determined.

Section 16. Other information

Hazardous Material Information System (U.S.A.)

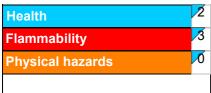

Procedure used to derive the classification

Classification	Justification
AMMABLE LIQUIDS - Category 2	On basis of test data
EYE IRRITATION - Category 2A	Calculation method
SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3	Calculation method
	Calculation method
AQUATIC HAZARD (LONG-TERM) - Category 3	Calculation method

History

Date of issue/Date of

revision

: 3/10/2023

Date of previous issue : 1/23/2022 **Version** : 1.01

985M Soldering Flux Page: 12/12 4060017 March 10 2023.

Section 16. Other information

Regulatory Affairs Department enthone.msds@macdermidenthone.com

Key to abbreviations : ATE = Acute Toxicity Estimate

BCF = Bioconcentration Factor

GHS = Globally Harmonized System of Classification and Labelling of Chemicals

IATA = International Air Transport Association

IBC = Intermediate Bulk Container

IMDG = International Maritime Dangerous Goods

LogPow = logarithm of the octanol/water partition coefficient

MARPOL = International Convention for the Prevention of Pollution From Ships, 1973

as modified by the Protocol of 1978. ("Marpol" = marine pollution)

N/A = Not available SGG = Segregation Group UN = United Nations

References : Not available.

Indicates information that has changed from previously issued version.

Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.

4.9.04b4933 Kester SDS GHS Americas