

Safety Data Sheet

Section 1. Identification

Product name : ALPHA® Rosin Flux 800

Product code : 115285
Product type : Liquid.

Date of issue/Date of

revision

: December 11 2024.

Manufacturer - Supplier	Telephone no.:	Emergency phone:
Alpha Assembly Solutions Inc. Global Headquarters 140 Centennial Avenue Piscataway, NJ 08854	Toll Free: (800) 367-5460 Main Phone: (908) 791-3000	DOMESTIC NORTH AMERICA 202-464-2554
ALPHA METALS MEXICO SA DE CV Ave Nafta 800, Parque Industrial STIVA Apodaca NL 66600 Mexico	Tel: +52 81 1156-6602	Tel: 01 800 022 1400 Tel: +52 55 5559-1588
Alpha Assembly Solutions Brasil Soldas Ltda Rio Jaguarão, 1540 - Vila Buriti Manaus Amazonas 69072-055 Brasil	Tel: 55 92 3614-7400	Tel: 55 92 3614-7423

Section 2. Hazards identification

OSHA/HCS status

: This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).

Classification of the substance or mixture

: FLAMMABLE LIQUIDS - Category 2 ACUTE TOXICITY (inhalation) - Category 4

EYE IRRITATION - Category 2A SKIN SENSITIZATION - Category 1

SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3

AQUATIC HAZARD (ACUTE) - Category 3 AQUATIC HAZARD (LONG-TERM) - Category 2

GHS label elements

Hazard pictograms :







Signal word : Danger

Hazard statements : Highly flammable liquid and vapor.

May cause an allergic skin reaction. Causes serious eye irritation.

Harmful if inhaled.

May cause drowsiness or dizziness.

Harmful to aquatic life.

Toxic to aquatic life with long lasting effects.

Precautionary statements

ALPHA® Rosin Flux 800 Page: 2/13 115285 December 11 2024.

Section 2. Hazards identification

Prevention

: Wear protective gloves, protective clothing and eye or face protection. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use explosion-proof electrical, ventilating or lighting equipment. Use non-sparking tools. Take action to prevent static discharges. Use only outdoors or in a well-ventilated area. Avoid release to the environment. Avoid breathing vapor. Wash thoroughly after handling. Contaminated work clothing must not be allowed out of the workplace.

Response

: Collect spillage. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Call a POISON CENTER or doctor if you feel unwell. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. Wash contaminated clothing before reuse. IF ON SKIN: Wash with plenty of water. If skin irritation or rash occurs: Get medical advice or attention. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. If eye irritation persists: Get medical advice or attention.

Storage

: Store locked up. Store in a well-ventilated place. Keep container tightly closed. Keep cool.

Disposal

: Dispose of contents and container in accordance with all local, regional, national and international regulations.

Supplemental label elements

: Avoid contact with skin and clothing. Wash thoroughly after handling.

Hazards not otherwise classified

: Prolonged or repeated contact may dry skin and cause irritation.

Section 3. Composition/information on ingredients

Substance/mixture : Mixture

Ingredient name	%	CAS number
Isopropyl alcohol	80-100	67-63-0
petroleum distillate	1-10	-
Organic acid	1-10	-
Rosin/Resin	0.1-1.0	-

A Trade Secret exemption is pending with the HMIRC for one or more ingredients in this product. Registry Number: 9642 on November 7, 2015

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of necessary first aid measures

Eye contact

: Check for and remove any contact lenses. Immediately flush eyes with running water for at least 30 minutes, keeping eyelids open. Get medical attention.

Inhalation

: Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that mists are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention. If necessary, call a poison center or physician. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

ALPHA® Rosin Flux 800 Page: 3/13 115285 December 11 2024.

Section 4. First aid measures

Skin contact

: Wash skin thoroughly with soap and water or use recognized skin cleanser. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 15 minutes. Get medical attention. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.

Ingestion

: Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Get medical attention. If necessary, call a poison center or physician. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

Most important symptoms/effects, acute and delayed

Potential acute health effects

Eye contact : Causes serious eye irritation.

Inhalation : Harmful if inhaled. Can cause central nervous system (CNS) depression. May cause

drowsiness or dizziness.

Skin contact: Defatting to the skin. May cause skin dryness and irritation. May cause an allergic skin

reaction.

Ingestion : Can cause central nervous system (CNS) depression.

Over-exposure signs/symptoms

Eye contact: Adverse symptoms may include the following:

pain or irritation watering

redness

Inhalation : Adverse symptoms may include the following:

nausea or vomiting

headache

drowsiness/fatigue dizziness/vertigo unconsciousness

Skin contact: Adverse symptoms may include the following:

irritation redness dryness cracking

Ingestion: No specific data.

Indication of immediate medical attention and special treatment needed, if necessary

Notes to physician : Treat symptomatically. Contact poison treatment specialist immediately if large

quantities have been ingested or inhaled.

Specific treatments: No specific treatment.

Protection of first-aiders : No action shall be taken involving any personal risk or without suitable training. If it is

suspected that mists are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water

before removing it, or wear gloves.

See toxicological information (Section 11)

ALPHA® Rosin Flux 800 Page: 4/13 115285 December 11 2024.

Section 5. Fire-fighting measures

Extinguishing media

Suitable extinguishing media

: Use dry chemical, CO2, water spray (fog) or foam.

Unsuitable extinguishing media

: Do not use water jet.

Specific hazards arising from the chemical

: Highly flammable liquid and vapor. Runoff to sewer may create fire or explosion hazard. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. The vapor/gas is heavier than air and will spread along the ground. Vapors may accumulate in low or confined areas or travel a considerable distance to a source of ignition and flash back. This material is toxic to aquatic life with long lasting effects. Fire water contaminated with this material must be contained and prevented from being discharged to any waterway, sewer or drain.

Hazardous thermal decomposition products : Decomposition products may include the following materials: carbon dioxide carbon monoxide

Special protective actions for fire-fighters

: Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.

Special protective equipment for fire-fighters : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

For non-emergency personnel

: No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing vapor or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.

For emergency responders: If specialized clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For nonemergency personnel".

Environmental precautions

: Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air). Water polluting material. May be harmful to the environment if released in large quantities. Collect spillage.

Methods and materials for containment and cleaning up

Small spill

: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.

Large spill

: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

ALPHA® Rosin Flux 800 Page: 5/13 115285 December 11 2024.

Section 6. Accidental release measures

Section 7. Handling and storage

Precautions for safe handling

Protective measures

Put on appropriate personal protective equipment (see Section 8). Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Do not get in eyes or on skin or clothing. Do not ingest. Avoid breathing vapor or mist. Avoid release to the environment. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. Empty containers retain product residue and can be hazardous. Do not reuse container.

Advice on general occupational hygiene

: Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

Conditions for safe storage, including any incompatibilities

: Store between the following temperatures: 10 to 43°C (50 to 109.4°F). Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Eliminate all ignition sources. Separate from oxidizing materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits

Isopropyl alcohol

ACGIH TLV (United States, 3/2017). Notes: Refers to Appendix A -

- Carcinogens. ACGIH 2003 Adoption STEL: 400 ppm 15 minutes.

TWA: 200 ppm 8 hours.

NIOSH REL (United States, 10/2016).

STEL: 1225 mg/m³ 15 minutes. STEL: 500 ppm 15 minutes. TWA: 980 mg/m³ 10 hours. TWA: 400 ppm 10 hours.

OSHA PEL (United States, 6/2016).

TWA: 980 mg/m³ 8 hours. TWA: 400 ppm 8 hours.

OSHA PEL 1989 (United States, 3/1989).

STEL: 1225 mg/m³ 15 minutes. STEL: 500 ppm 15 minutes. TWA: 980 mg/m³ 8 hours. TWA: 400 ppm 8 hours.

Proprietary petroleum distillate

OSHA PEL (United States).

TWA: 500 ppm 8 hours.

ACGIH TLV (United States, 3/2017). Absorbed through skin.

TWA: 200 mg/m³, (as total hydrocarbon vapor) 8 hours.

ACGIH TLV (United States, 3/2017).

petroleum distillate

ALPHA® Rosin Flux 800 Page: 6/13 115285 December 11 2024.

Section 8. Exposure controls/personal protection

TWA: 200 ppm 8 hours. TWA: 1050 mg/m³ 8 hours.

NIOSH REL (United States, 10/2016).

TWA: 1050 mg/m³ 10 hours. TWA: 200 ppm 10 hours.

OSHA PEL 1989 (United States, 3/1989).

TWA: 1050 mg/m³ 8 hours. TWA: 200 ppm 8 hours.

ACGIH TLV (United States, 3/2017). Skin sensitizer. Inhalation

sensitizer.

Appropriate engineering controls

Rosin/Resin

Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.

Environmental exposure controls

: Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures

Hygiene measures

: Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.

Eye/face protection

: Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: chemical splash goggles.

Skin protection Hand protection

: Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.

Body protection

: Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear antistatic protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.

Other skin protection

: Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.

Respiratory protection

: Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

ALPHA® Rosin Flux 800 Page: 7/13 115285 **December 11 2024**

Section 9. Physical and chemical properties and safety characteristics

The conditions of measurement of all properties are at standard temperature and pressure unless otherwise indicated.

Appearance

Physical state : Liquid.

Color : Clear. Amber. Odor : Alcohol-like. [Slight]

: Not available. **Odor threshold**

Ha

: 0°C (32°F) **Melting point/freezing point Boiling point, initial boiling** : 82°C (179.6°F)

point, and boiling range

: Closed cup: 12.222°C (54°F) [Tag Closed Cup] Flash point

Evaporation rate : Not available. : Not available. **Flammability** : Not available. Lower and upper explosion

limit/flammability limit

Vapor pressure : Not available. Relative vapor density : >1 [Air = 1] Relative density 0.794

Solubility : Easily soluble in the following materials: cold water.

VOC : 783.3 q/l

Partition coefficient: n-

octanol/water

: Not applicable.

Auto-ignition temperature : 399°C (750.2°F) **Decomposition temperature** : Not available. : Not available. **Viscosity** Flow time (ISO 2431) : Not available.

Particle characteristics

Median particle size : Not applicable.

Section 10. Stability and reactivity

Reactivity **Chemical stability** : No specific test data related to reactivity available for this product or its ingredients.

Possibility of hazardous

reactions

: Under normal conditions of storage and use, hazardous reactions will not occur.

Conditions to avoid

: Avoid all possible sources of ignition (spark or flame). Do not pressurize, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition. Do not allow vapor to accumulate in low or confined areas.

Incompatibility with various

substances

Slightly reactive or incompatible with the following materials: oxidizing materials, reducing materials, organic materials, acids and alkalis.

Non-reactive or compatible with the following materials: combustible materials, metals

and moisture.

: The product is stable.

Hazardous decomposition

products

: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Other Hazardous

decomposition products

: carbon oxides (CO, CO₂)

Hazardous polymerization : Under normal conditions of storage and use, hazardous polymerization will not occur.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
Isopropyl alcohol	LD50 Dermal	Rabbit	6290 mg/kg	-
	LD50 Oral	Rat	4.7 g/kg	-
petroleum distillate	LC50 Inhalation Gas.	Rat	3200 ppm	4 hours
	LC50 Inhalation Vapor	Rat	6400 ppm	1 hours
	LC50 Inhalation Vapor	Rat	17000 mg/m ³	4 hours
succinic acid	LD50 Oral	Rat	2260 mg/kg	-
Rosin/Resin	LD50 Oral	Mouse	2.2 g/kg	-
	LD50 Oral	Rat	3 g/kg	-

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
Isopropyl alcohol	Eyes - Moderate irritant	Rabbit	-	24 hours 100 milligrams	-
	Eyes - Moderate irritant	Rabbit	-	10 milligrams	-
	Eyes - Severe irritant	Rabbit	-	100 milligrams	-
	Skin - Mild irritant	Rabbit	-	500 milligrams	-
petroleum distillate	Skin - Mild irritant	Pig	-	24 hours 250 microliters	-
	Skin - Moderate irritant	Rat	-	96 hours 300 microliters	-
succinic acid	Eyes - Severe irritant	Rabbit	-	750 Micrograms	-

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

Classification

Product/ingredient name	OSHA	IARC	NTP
Isopropyl alcohol	-	3	-

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Product/ingredient name	Category	Route of exposure	Target organs
Isopropyl alcohol petroleum distillate	Category 3 Category 3	-	Narcotic effects Narcotic effects

Specific target organ toxicity (repeated exposure)

Not available.

Aspiration hazard

ALPHA® Rosin Flux 800 Page: 9/13 115285 December 11 2024.

Section 11. Toxicological information

Product/ingredient name	Result
	ASPIRATION HAZARD - Category 1 ASPIRATION HAZARD - Category 1

Information on the likely routes of exposure

: Dermal contact. Eye contact. Inhalation. Ingestion.

Potential acute health effects

Eye contact: Causes serious eye irritation.

Inhalation : Harmful if inhaled. Can cause central nervous system (CNS) depression. May cause

drowsiness or dizziness.

Skin contact : Defatting to the skin. May cause skin dryness and irritation. May cause an allergic skin

reaction.

Ingestion : Can cause central nervous system (CNS) depression.

Symptoms related to the physical, chemical and toxicological characteristics

Eye contact: Adverse symptoms may include the following:

pain or irritation watering redness

Inhalation : Adverse symptoms may include the following:

nausea or vomiting

headache

drowsiness/fatigue dizziness/vertigo unconsciousness

Skin contact: Adverse symptoms may include the following:

irritation redness dryness cracking

Ingestion : No specific data.

Delayed and immediate effects and also chronic effects from short and long term exposure

Short term exposure

Potential immediate : Not available.

effects

Potential delayed effects : Not available.

Long term exposure

Potential immediate : Not available.

effects

Potential delayed effects : Not available.

Potential chronic health effects

Not available.

General: Prolonged or repeated contact can defat the skin and lead to irritation, cracking and/or

dermatitis. Once sensitized, a severe allergic reaction may occur when subsequently

exposed to very low levels.

Carcinogenicity
 No known significant effects or critical hazards.
 Mutagenicity
 No known significant effects or critical hazards.
 Reproductive toxicity
 No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

ALPHA® Rosin Flux 800	Page: 10/13
115285	December 11 2024.

Section 11. Toxicological information

Route	ATE value
Oral	4576.87 mg/kg
Dermal	218737.5 mg/kg
Inhalation (gases)	4025.6 ppm
Inhalation (vapors)	21.39 mg/l

Section 12. Ecological information

Toxicity

Product/ingredient name	Result	Species	Exposure
Isopropyl alcohol	Acute EC50 10100 mg/l Fresh water Acute LC50 1400000 µg/l Marine water Acute LC50 4200 mg/l Fresh water	Daphnia - Daphnia magna Crustaceans - Crangon crangon Fish - Rasbora heteromorpha	48 hours 48 hours 96 hours
Proprietary petroleum distillate	Acute LC50 2200 μg/l Fresh water	Fish - Lepomis macrochirus	4 days
succinic acid	Acute EC50 374200 μg/l Fresh water	Daphnia - Daphnia magna - Larvae	48 hours

Persistence and degradability

Not available.

Bioaccumulative potential

Product/ingredient name	LogPow	BCF	Potential
Isopropyl alcohol	0.05	-	low
petroleum distillate	5.65	105	low
succinic acid	-0.59	-	low
Rosin/Resin	1.9 to 7.7	-	high

Mobility in soil

Soil/water partition coefficient (Koc)

: Not available.

Other adverse effects

: No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods

The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapor from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Section 14. Transport information

	DOT Classification	TDG Classification	Mexico Classification	UN	IMDG	IATA
UN number	UN1219	UN1219	UN1219	UN1219	UN1219	UN1219
UN proper shipping name	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution	Isopropanol solution
Transport hazard class(es)	3	3	3	3	3	3
Packing group	II	II	II	II	II	II
Environmental hazards	No.	Yes. The environmentally hazardous substance mark is not required.	Yes. The environmentally hazardous substance mark is not required.	Yes. The environmentally hazardous substance mark is not required.	Yes.	Yes. The environmentally hazardous substance mark is not required.

Additional information - DOT Classification	ERG# 129
Additional information - IMDG Classification	The marine pollutant mark is not required when transported in sizes of ≤5 L or ≤5 kg.
Additional information - IATA Classification	The environmentally hazardous substance mark may appear if required by other transportation regulations.

Special precautions for user : Transport within user's premises: always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

Section 15. Regulatory information

U.S. Federal regulations

: TSCA 5(a)2 proposed significant new use rule (SNUR): No products were found. TSCA 5(a)2 final significant new use rule (SNUR): No products were found.

TSCA 12(b) one-time export: petroleum distillate

TSCA 12(b) annual export notification: No products were found.

United States inventory (TSCA 8b)

: All components are listed or exempted.

SARA 302/304

Composition/information on ingredients

ALPHA® Rosin Flux 800 Page: 12/13 115285 December 11 2024.

Section 15. Regulatory information

No products were found.

SARA 311/312

Classification : FLAMMABLE LIQUIDS - Category 2

ACUTE TOXICITY (inhalation) - Category 4

EYE IRRITATION - Category 2A SKIN SENSITIZATION - Category 1

SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3

HNOC - Defatting irritant

California Prop. 65

This product does not require a Safe Harbor warning under California Prop. 65.

Canada

Canada inventory : All components are listed or exempted.

International regulations

Inventory list

Australia : Not determined.


China : All components are listed or exempted.Japan : All components are listed or exempted.

New Zealand: Not determined.Philippines: Not determined.Republic of Korea: Not determined.

Taiwan : All components are listed or exempted.

Section 16. Other information

Hazardous Material Information System (U.S.A.)

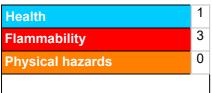

Procedure used to derive the classification

Classification	Justification
FLAMMABLE LIQUIDS - Category 2	On basis of test data
ACUTE TOXICITY (inhalation) - Category 4	Calculation method
EYE IRRITATION - Category 2A	Calculation method
SKIN SENSITIZATION - Category 1	Calculation method
SPECIFIC TARGET ORGAN TOXICITY (Narcotic effects) - Category 3	Calculation method
AQUATIC HAZARD (ACUTE) - Category 3	Calculation method
AQUATIC HAZARD (LONG-TERM) - Category 2	Calculation method

History

Date of issue/Date of

: 12/11/2024

revision

Date of previous issue : 11/3/2023 Version : 4.14

Regulatory Affairs Department

enthone.msds@macdermidenthone.com

ALPHA® Rosin Flux 800 Page: 13/13 115285 December 11 2024.

Section 16. Other information

Key to abbreviations

: ATE = Acute Toxicity Estimate

BCF = Bioconcentration Factor

GHS = Globally Harmonized System of Classification and Labelling of Chemicals

IATA = International Air Transport Association

IBC = Intermediate Bulk Container

IMDG = International Maritime Dangerous Goods

LogPow = logarithm of the octanol/water partition coefficient

MARPOL = International Convention for the Prevention of Pollution From Ships, 1973

as modified by the Protocol of 1978. ("Marpol" = marine pollution)

N/A = Not available

SGG = Segregation Group UN = United Nations

References : Not available.

Indicates information that has changed from previously issued version.

Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.

4.12.3.4 b7396 MAES SDS GHS Americas